

CUSTOMER #: 1030164

488410

Niello Volkswagen



Das Auto.

2701 Arden Way  
Sacramento, CA 95825  
916.482.5790  
vw.niello.com

\*INVOICE\*

PAGE 1

STEVE MCEVOY  
12 MCKILT CT  
SACRAMENTO, CA 95835-1334  
dnh@a.com  
HOME:916-275-4710 CONT:916-275-4710

BAR # ARD-020183 E.P.A. # CAD028041781

BUS: CELL: SERVICE ADVISOR: 702 DANA ROSS

COLOR	YEAR	MAKE/MODEL		VIN	LICENSE	MILEAGE IN/ OUT		TAG
ORANGE ART	00	VOLKSWAGEN NEW BEETL		3VWCD21C6YM489497	6GLH898	144480/144482		T1889
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE	
28JUL00 DD			17:00 23MAY19			CASH	24MAY19	

R.O. OPENED READY OPTIONS: ENG:APH/1.8T TRN:EBQ/AUTO 1) EXTERIOR  
2) INTERIOR ZA

11:48 22MAY19 17:18 24MAY19

LINE OPCODE TECH TYPE HOURS LIST NET TOTAL

A CUSTOMER STATES THERE IS AN OIL LEAK. PLEASE CHECK AND ADVISE

10 CUSTOMER STATES THERE IS AN OIL LEAK. PLEASE  
CHECK AND ADVISE

50 CVW

0.00 0.00

10 REPLACE CAM TENSIONER SEAL AND VALVE COVER  
GASKET

50 CVW

561.00 561.00

1 06A-103-663-B FUNNEL

17.91 17.91 17.91

1 058-198-025-A GASKET SET

62.70 62.70 62.70

1 058-198-217 GASKET SET

17.67 17.67 17.67

1 10%D454300A2 SEALANT

12.54 12.54 12.54

10 REPLACE PCV ELBOW, T AND VALVE

50 CVW

412.50 412.50

1 06A-103-213-F TUBE

83.60 83.60 83.60

1 N-904-673-01 SEAL RING

6.14 6.14 6.14

1 06A-103-247 HOUSING

17.91 17.91 17.91

1 035-103-245-A VALVE

23.22 23.22 23.22

3 53912032 HOSE CLAMP

1.99 1.99 5.97

1 53911220 CLAMP

1.99 1.99 1.99

10 REPLACE CAM TENSIONER

50 CVWS

62.50 62.50

1 NPN-35944 TENSIONER

147.71 147.71 147.71

PARTS: 397.36 LABOR: 1036.00 OTHER: 0.00 TOTAL LINE A: 1433.36

144480 INSPECTED THE ENGINE FOR AN OIL LEAK AND FOUND THERE ARE 3  
SOURCES. 1 THE VALVE COVER APPEARS TO HAVE BEEN SEALED WITH THE  
INCORRECT SEALANT, 2 THE CAM TENS SEAL IS LEAKING, AND 3 THE PCV ELBOW  
IS CRACKED AND LEAKING. WE WILL NEED TO REPLACE ALL 3. THERE IS ALSO  
SOME P/S FLUID AROUND THE RESERVOIR BUT IT LOOKS LIKE ITS RESIDUAL.  
REPLACED THE PCV T, THE PCV VALVE AND THE PCV ELBOW ON THE BLOCK ALSO  
REPLACED THE DIPSTICK EXTENSION DURING REPAIRS. REPLACED THE CAM  
TENSIONER SEAL AND THE V/C GASKET. CLEANED THE INCORRECT SEALANT FROM  
THE ENGINE AND FOUND THE CAM TENSIONER WILL NEED TO BE REPLACED BECAUSE  
THE TENSIONING TOOL HAS BROKEN THE TENSIONER. REPLACED THE TENSIONER  
AND VERIFIED THE CAM TIMING. FOUND THE ENGINE RUNS AS IT SHOULD. I DID

ORIGINAL ESTIMATE <u>279</u>		AUTHORIZED BY _____		DESCRIPTION		TOTALS
PHONE # _____		DATE _____ TIME _____		LABOR AMOUNT		
DATE	TIME	PHONE #	AUTHORIZED BY	ADDITIONAL AMOUNT	REVISED AMOUNT	REVISION DETAILS
I ACKNOWLEDGED NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATE PRICE.						PLEASE PAY THIS AMOUNT
I ACKNOWLEDGED RECEIPT OF VEHICLE AND I HAVE RECEIVED A COPY OF THIS INVOICE.						

Notice to Consumer: Please read important information on back.

CUSTOMER COPY

CUSTOMER #: 1030164

488410

Niello Volkswagen



2701 Arden Way  
Sacramento, CA 95825  
916.482.5790  
vw.niello.com

Das Auto.

STEVE MCEVOY  
12 MCKILT CT  
SACRAMENTO, CA 95835-1334

\*INVOICE\*

PAGE 2

dnh@a.com

HOME:916-275-4710 CONT:916-275-4710

BAR # ARD-020183 E.P.A. # CAD029041761

BUS: CELL: SERVICE ADVISOR: 702 DANA ROSS

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
ORANGE ART	00	VOLKSWAGEN NEW BEETL	3VWCD21C6YM489497	6GLH898	144480/144482	T1889	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PD NO.	RATE	PAYMENT	INV. DATE
28JUL00 DD			17:00 23MAY19			CASH	24MAY19
R.O. OPENED		READY		OPTIONS: ENG:APH/1.8T TRN:EBQ/AUTO 1) EXTERIOR			
11:48 22MAY19		17:18 24MAY19		2) INTERIOR ZA			

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
FIND DURING REPAIRS THAT THE SECONDARY AIR INJECTION PUMP IS COMING APART AND SQUEALING WHEN THE PUMP WORKS. I SHOWED THE ADVISOR WHERE THEY COULD INSTALL A BOLT AND THIS SHOULD TAKE CARE OF THIS CONCERN. I ALSO FOUND THE BRAKE BOOSTER VACUUM HOSE IS LOOSE AT THE BOOSTER AND THIS CAN CAUSE A VACUUM LEAK AND OR A ROUGH IDLE. ALSO FOUND THERE IS ONE CLIP MISSING ON THE TIMING COVER AND THE ELECTRICAL CONNECTOR HOUSINGS ARE BROKEN ON ALL 4 COILS.							

\*\*\*\*\*

B VI NO CHARGE VEHICLE VISUAL INSPECTION (VALUE \$79.95)

VI VI NO CHARGE VEHICLE VISUAL INSPECTION (VALUE  
\$79.95)

	50	CVW				0.00	0.00
PARTS:	0.00	LABOR:	0.00	OTHER:	0.00	TOTAL LINE B:	0.00
144480 RE3COMMEND REPAIRS AS PER VISUAL INSPECTION. FOUND THE AIRBAG LIGHT IS ON, THE CONSOLE IS LOOSE AND THE LATCH IS BROKEN, THE P/S LICENCE PLATE LIGHT IS INOP, THE WIPER BLADES ARE INCORRECT, THE DIPSTICK TUBS IS SLIGHTLY BROKEN, THE HIGH MOUNT BRAKE LIGHT LOOKS LIKE IT IS LEAKING, THE D/S DOOR LATCH IS NOT WORKING PROPERLY AND WILL NOT LOCK SOMETIMES AND IT ALSO DOES NOT READ SO WEHN IT'S CLOSED IT CAN BE OPENED WITHOUT THE ALARM ACTIVATING, ALL 3 SPLASH SHIELDS ARE BROKEN, AND THERE IS NO RECORD OF THE MAJOR SERVICE OR THE BRAKE FLUSH. ALSO NOTE. THE D/S FRONT FENDER IS CRACKED.							

\*\*\*\*\*

C CIA CHECK AND INFLATE SERVICE

CIA CIA CHECK AND INFLATE SERVICE

	50	CVW				0.00	0.00
PARTS:	0.00	LABOR:	0.00	OTHER:	0.00	TOTAL LINE C:	0.00
*****							

\*\*\*\*\*

D WASH CUSTOMER AUTHORIZES COURTESY EXTERIOR HAND CAR WASH

WASH WASH CUSTOMER AUTHORIZES COURTESY EXTERIOR  
HAND CAR WASH

	50	CVW				0.00	0.00
PARTS:	0.00	LABOR:	0.00	OTHER:	0.00	TOTAL LINE D:	0.00

\*\*\*\*\*

ORIGINAL ESTIMATE		AUTHORIZED BY		DESCRIPTION		TOTALS
PHONE #	DATE	DATE	TIME	LABOR AMOUNT		
DATE	TIME	PHONE #	AUTHORIZED BY	ADDITIONAL AMOUNT	REVISED AMOUNT	REVISION DETAILS
I ACKNOWLEDGED NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATE PRICE.				I ACKNOWLEDGED RECEIPT OF VEHICLE AND I HAVE RECEIVED A COPY OF THIS INVOICE		PLEASE PAY THIS AMOUNT
X				X		

Notice to Consumer: Please read important information on back.

CUSTOMER COPY

CUSTOMER #: 1030164

488410

Niello Volkswagen



Das Auto.

STEVE MCEVOY  
12 MCKILT CT  
SACRAMENTO, CA 95835-1334  
dnh@a.com

\*INVOICE\*

2701 Arden Way  
Sacramento, CA 95825  
916.482.5790  
ww.niello.com

PAGE 3

BAR # ARD-020183 E.P.A. # CAD029041761

HOME: 916-275-4710 CONT: 916-275-4710

BUS: CELL: SERVICE ADVISOR: 702 DANA ROSS

COLOR		YEAR	MAKE/MODEL		VIN	LICENSE	MILEAGE IN/ OUT		TAG
ORANGE ART		00	VOLKSWAGEN NEW BEETL		3VWCD21C6YM489497	6GLH898	144480/144482		T1889
DEL DATE		PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT		INV. DATE
28JUL00 DD				17:00 23MAY19			CASH		24MAY19
R.O. OPENED		READY		OPTIONS					

LINE OPCODE TECH TYPE HOURS LIST NET TOTAL  
E\*\* CUSTOMER STATES THE FUEL DOR AT TIME WILL NOT OPEN. IT RELEASES BUT  
DOES NOT POP OUT WHEN SWITCH IS TRIGGERED. PLEASE CHECK AND  
ADVISE

20 \*\* FUEL SYSTEM AND RELATED REAPIR

50 CVW

82.50 82.50

PARTS: 0.00 LABOR: 82.50 OTHER: 0.00 TOTAL LINE E: 82.50


144480 INSPECTED THE FUEL DOOR AND FOUND THE GAS DOOR POPS EVERY  
TIME I PUSH THE RELEASE BUTTON. THERE IS A POSSIBILITY THE SOLENOID AND  
OR CABLE ARE BINDING BASED ON TEMPERATURE OR TIME. WE CAN REPLACE THESE  
2 COMPONENTS BUT THAT IS REALLY ALL THERE IS TO THIS SYSTEM. THE SPRING  
IN THE GAS DOOR IS IN TACT AND THERE ARE NO SIGNS OF THE GAS DOOR  
BINDING.

\*\*\*\*\*

EST: 0.00 22MAY19 11:48 SA: 702

THANK YOU FOR VISITING NIELLO VW FOR SERVICE.  
WE APPRECIATE YOUR BUSINESS.

WE NOW OFFER XPRESS SERVICE  
MONDAY - SATURDAY 8AM TO 5PM  
NO APPOINTMENT NEEDED!!!!

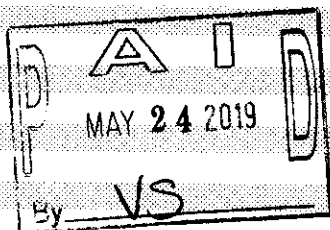

NIELLO VOLKSWAGEN  
2701 ARDEN WAY  
SACRAMENTO, CA 95825

CREDIT CARD

VISA SALE

XXXXXXXXXXXX8168

VISA CREDIT

A0000000031010

0009

F180008E9CFFD18

20

914

20

024628

Chip Read

Issuer

\$1546.66

05/24/2019

17:41:19

Card #

Chip Card:

AID:

ATC:

ARQC:

SEQ #:

Batch #:

INVOICE

Approval Code:

Entry Method:

Mode:

SALE AMOUNT

CUSTOMER COPY

DATE	TIME	PHONE #	AUTHORIZED BY	ADD AN

I ACKNOWLEDGED NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATE PRICE.

I ACKNOWLEDGED RECEIPT OF VEHICLE AND I HAVE RECEIVED A COPY OF THIS INVOICE.

PLEASE PAY THIS AMOUNT

1546.66

Notice to Consumer: Please read important information on back.

CUSTOMER COPY